


POWERFUL SOLUTIONS. GLOBAL FORCE.

Repair Parts Sheet

RC-502, RC-504, RC-506, RC-5013 RC-Duo Hydraulic Cylinders

Repair Parts Sheet	Revision	Revision Date	Product Code Beginning	
L3021	Rev. D	07/2015	С	

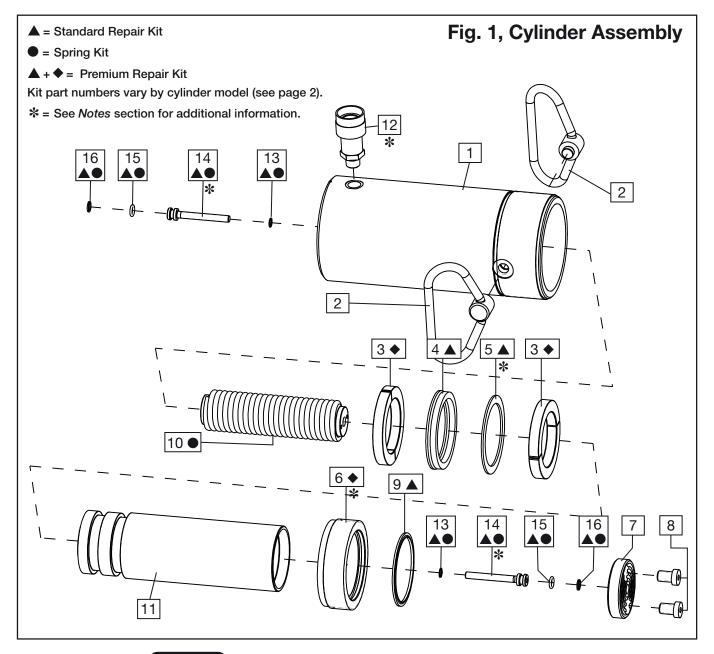



Note: See Page 2 for parts list.

(*) Notes				
Item	Torque / notes			
5	Washer to be placed with the sharp edge towards U-Cup.			
6	Secure with Loctite 222.			
12	54 - 81 Nm, 40 - 60 Ft - Lbs			
12	Use Loctite 545 or Teflon tape.			
14	10.2 - 12.4 Nm, 90 - 110 In - Lbs			

Repair Parts List, Figure 1

L3021

Item	Description	Qty.	Part Number			
			RC-502	RC-504	RC-506	RC-5013
1	Base	1	(not available)	(not available)	(not available)	(not available)
2	Handle	2	ACH75	ACH75	ACH75	ACH75
3	Bearing	2	*	•	•	•
4	U-Cup	1	A	A	A	A
5	Washer	1	A	A	A	A
6	Stop Ring	1	•	•	*	•
7	Saddle, Grooved (incl. #8)	1	L345045SR	L345045SR	L345045SR	L345045SR
8	Cap Screw	2	A	A	A	A
9	Wiper Ring	1	A	A	A	A
10	Spring	1	•	•	•	•
11	Plunger	1	DD2317040	DD2319040	DD2321040	DD2313040
12	Coupler	1	CR-400	CR-400	CR-400	CR-400
13	Gasket	2	A •	A •	A •	A •
14	Spring Retainer	2	A •	A •	A •	A •
15	O-Ring	2	A •	A •	A •	A •
16	Back-up	2	A •	A •	A •	A •
N/S	Dust Cap	1	A	A	A	A
N/S	Thread Protector	1	A	A	A	A
N/S	O-Ring Coupler	1	A	A	A	A
N/S	Enerpac Decal	1	A	A	A	A
N/S	Warning Decal	1	A	A	A	A
A	Repair Kit, Standard	-	RC50K51	RC50K51	RC50K51	RC50K52
+ +	Repair Kit, Premium	- 1	RC50K71	RC50K71	RC50K71	RC50K72
•	Spring Kit	- 1	RC50K31	RC50K32	RC50K33	RC50K34

Notes:

Premium repair kit includes all standard (\blacktriangle) repair kit items plus additional premium (\spadesuit) items. N/S = Item not shown.

Cylinders with Viton components only: Order Repair Kit RC506KV in addition to Repair Kit RC50K51, RC50K52, RC50K71 or RC50K72 (refer to chart, above). Repair Kit RC506KV includes Viton components for items 4 and 9. Standard components are used in other locations.



To maintain your warranty:

- Use only Enerpac Oil
- Have your products inspected and repaired by an Enerpac Authorized Service Center



Visit www.enerpac.com for the location of the Enerpac Authorized Service Center nearest you.